

Case 367 : Narrative

Case Vehicle (A): 2002 Dodge	Vehicle (B): 2002 Ford
Type: Dakota Sport, 4 x 2, 4-door pickup	Type: Explorer XLS, 4 x 4, 4-door SUV
Driver: 61-year-old male	Driver: 44-year-old female
CDC: 12-FYEW-4	CDC: 01-FDEW-3

SITUATION

1 It was dark and snowing, and the two-lane asphalt roadway was snow covered and slippery when 2 case vehicle (A) was traveling south at an unknown speed in the southbound lane and 3 vehicle (B) was traveling north at an unknown speed in the northbound lane. As the two vehicles approached each other, the driver of vehicle (B) lost control of the vehicle due to the slippery road conditions and vehicle (B) veered onto the right shoulder of the road. The driver of vehicle (B) steered to the left to reenter the roadway and the vehicle crossed the northbound lane and went into the southbound lane where the front end struck the left front of case vehicle (A). Both vehicles were towed due to damage.

The police accident report indicates A-level injuries for the driver and right-front passenger of case vehicle (A), who were transported to a level-one trauma center by ambulance and hospitalized for seven days. The police accident report indicates C-level injuries for the driver and O-level injuries for the right-front passenger of vehicle (B), but neither sought medical treatment. The driver of vehicle (B) had been drinking and a blood alcohol test revealed a blood alcohol level of .05 percent.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[4](#) [5](#) Damage to case vehicle (A) was severe. Direct damage to the front began at the left-front bumper corner and extended 95-cm to the right, resulting in 58-percent vehicle overlap (VOL). [6](#) The maximum crush was 79 cm at the left-front bumper corner.

[7](#) [8](#) Damage to vehicle (B) was severe. [9](#) Direct damage extended across the entire frontal plane. [10](#) The maximum crush was 63 cm at the right-front bumper corner. [11](#) The left fender was shifted 46 cm to the left, [12](#) the left wheelbase was reduced by 9 cm, and the right wheelbase was reduced by 3 cm.

Using the WinSMASH crash-reconstruction program and crush profiles measured for [13](#) [14](#) [15](#) [16](#) case vehicle (A) and [17](#) [18](#) [19](#) [20](#) vehicle (B), the following impact severities were estimated:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case vehicle (A)	delta V	45 (28)	-44 (-27)	8 (5)
Vehicle (B)	delta V	45 (28)	-39 (-24)	-22 (-14)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

In the front, [21](#) the left and center portions of the bumper, the grille, and the hood were crushed rearward. [22](#) The hood was buckled and the hood latch was damaged and jammed closed. [23](#) The left hood hinge was bent to the left, [24](#) the

right hood hinge was deflected to the right, and [25](#) the rear edge of the hood was elevated and [26](#) it contacted and cracked the lower-left portion of the windshield. [27](#) The right portion of the windshield was cracked due to body distortion.

On the left side, [28](#) the fender, the front wheel, and the upper and lower sections of the A-pillar were crushed rearward. [29](#) The left-front wheel rim was dented, the tire was flat, and tire rotation was restricted from contact with the wheel well. [30](#) The driver door was reportedly jammed closed after the impact but the left-rear door had remained closed and operational. However, [31](#) [32](#) rescue personnel had cut the upper sections of the A- and B-pillars and [33](#) [34](#) had removed both left-side doors at the hinges to extricate the driver. [35](#) The glazing of the driver door was broken out but [36](#) the left-rear door glazing was intact. [37](#) There was no other left-side damage, but the left wheelbase was reduced 56 cm.

[38](#) There was no damage to the rear of the case vehicle. [39](#) On the right side, the sheet metal on the forward portion of the fender was displaced to the left. [40](#) Both right-side doors remained closed and operational and all right-side glazing was intact. [41](#) There was no other right-side damage, but the right wheelbase was increased 7 cm.

Interior

Case vehicle (A) was equipped with steering-wheel and dash-mounted frontal-impact airbags, and [42](#) [43](#) [44](#) [45](#) both deployed during the frontal impact. There was no damage to the steering-wheel airbag but the fabric was stained with blood. [46](#) There was no damage to the steering-wheel airbag module covers. [47](#)

[48](#) The lower rim of the steering-wheel was bent forward 9 cm. [49](#) The steering column was deflected up and to the right. [50](#) [51](#) The interior panel of the driver door had been removed and the panel and the forward portion was cracked and broken. The door hardware and the door armrest were scuffed and the door

glazing was broken out. [52](#) The left roof siderail and roof were buckled. [53](#) The upper portion of the left A-pillar cover had been cut by rescue and it was twisted, and the windshield header was deflected up and to the rear. [54](#) The upper instrument panel was bowed and it was split above and to the left of the steering wheel. [55](#) The far-left portion of the mid-instrument panel plastic was scuffed and cracked. [56](#) The driver knee bolster cover below and to the right of the steering column was scuffed and loosened, [57](#) [58](#) but the backside of the knee bolster cover was undamaged. [59](#) The left side of the driver-seat backrest was dented, the seat was leaning to the left, and the seat adjuster was jammed with the seat in a mid-track position. [60](#) The instrument-panel covers were broken, the control knob and levers were knocked off, the upper vent outlets were displaced, and [61](#) the gas pedal was bent.

[62](#) In the center-front area, the roof-mounted console was displaced, the face of the center instrument stack was dislodged and scuffed, and [63](#) the face of the vertical console was broken in several places. [64](#) The floor-mounted transmission selection knob was detached from the shift lever and [65](#) the center console armrest was deflected to the left.

[66](#) [67](#) [68](#) [69](#) [70](#) In the right-front passenger area, there was no damage to the dash-mounted airbag or module cover, but the airbag fabric was stained with drops of blood and had been punctured by a hypodermic needle used by EMS following the crash. [71](#) The glove-compartment door was scuffed and the heater duct had become partially detached. [72](#) There was no other damage to the right-front passenger area.

[73](#) [74](#) [75](#) [76](#) There was no other interior damage. The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
Driver	toepan 77	39	to rear
instrument panel 78	36	to rear	
footwell panel 79	27	to right	
steering column 80	24	to rear	
windshield header 81	8	to rear	
roof siderail	5	to right	
Right front	toepan 82 83	16	to rear
	instrument panel	9	to rear

OCCUPANT KINEMATICS AND INJURIES

[84](#) The 5-ft, 9-in, 180-lb, 61-year-old male driver was using the available three-point belt [85](#) and the steering-wheel airbag deployed. [86](#) The belt webbing was cut by rescue, and [87](#) webbing marks on the D-ring and [88](#) sliding latch plate indicate belt use.

On impact, the driver moved forward relative to the vehicle interior into the seatbelt and airbag. He sustained a contusion to the left shoulder, possibly due to loading by the shoulder belt. He sustained lacerations to the left side of the forehead and the right side of the lower lip, and an abrasion to the right eyelid, possibly from contact by the deploying airbag and/or from the airbag flinging his right hand into his face, as indicated by contusions to the dorsal aspect of his hand and fingers. He sustained contusions to the medial aspect of the right upper arm and right forearm, possibly from contact by the deploying airbag. He sustained contusions to the palmar aspect of the left fingers and a laceration to the palmar aspect of the left hand, possibly from contact with the steering-wheel rim and/or contact with the instrument panel. He sustained fractures to the

anterolateral aspect of right ribs 3 through 7 and contusions to the upper-right area of the chest from unknown sources. He sustained contusions to the upper-left area of the abdomen, possibly due to contact with the steering-wheel rim, [89](#) as evidenced by the deformed lower rim of the steering wheel. He sustained fractures to the posterior aspect of left ribs 6 and 7 with hemothorax and a left pulmonary contusion from unknown sources. He sustained a contusion to the right elbow, possibly due to contact by the right-front passenger. He sustained a fracture to the left femoral neck and comminuted fractures to the proximal aspects of the left tibia and fibula, probably due to contact with the knee bolster, [56](#) as evidenced by scuffmarks. He sustained an open comminuted fracture to the right calcaneous with partial disarticulation, fractures to the intra-articular aspect of the first phalange and navicular bone of the left foot, and contusions to the left toes, probably due to contact with the toepan.

[90](#) The 5-ft, 5-in, 146-lb, 49-year-old female right-front passenger was using the available three-point belt [91](#) and the dash-mounted airbag deployed. [92](#) Load marks on the D-ring from the belt webbing indicate belt use.

Just prior to impact, the right-front passenger reportedly reached out to brace herself by placing her left hand on the center instrument stack. During the frontal impact, she moved forward into the belt restraints and airbag. She sustained a displaced fracture to the shaft of the left radius and a comminuted fracture to the shaft of the left ulna, probably due to bracing against the center stack, but possibly due to contact by the deploying airbag. She sustained an abrasion to the left side of the nose, probably from contact by the deploying airbag. She sustained contusions to the right and left lower regions of the abdomen and abrasions to the right and left hips, probably from loading by the lap belt. She sustained a contusion to the lateral aspect of the left knee and a contusion and abrasion to the medial aspect of the right knee, probably due to knee contact with the knee bolster/glove-box door, [71](#) as evidenced by a scuffmark. She sustained

fractures to the right medial malleolus and right navicular bone, and a comminuted fracture to the right cuboid bone that extended into the articular surface, probably from loading of the right foot by the toepan.

The following tables and attached drawings [93](#) [94](#) summarize the injuries for the two occupants of case vehicle (A).

Occupant: Driver	Age: 61 years	Gender: Male		
Restraints: Three-point belt; steering-wheel airbag	Stature: 175 cm (5 ft, 9 in)	Mass: 82 kg (180 lb)		
Injury Description		A.I.S.	Injury Source	
—		—	Definite	Probable
		Possible		
Lacerations, left side of forehead and right side of lower lip	1	—	—	Airbag; right hand (airbag fling)
Abrasion, right eyelid	1	—	—	Airbag/eyeglasses; right hand (airbag fling)
Contusions, dorsal aspect of the right hand and fingers	1	—	—	Face (airbag fling)
Contusions, medial aspects of the right upper arm and right forearm	1	—	—	Airbag
Contusion, right elbow	1	—	—	Right-front passenger
Fractures, anterolateral aspect of right ribs 3 through 7	3	Unknown	—	—
Contusions, upper-right region of chest	1	Unknown	—	—
Contusion, upper-left aspect of abdomen	1	—	—	Lower steering-wheel rim
Contusions, palmar aspect of the left fingers	1	—	—	Steering-wheel rim; instrument panel
Laceration, palmar aspect of the left hand	1	—	—	Steering-wheel rim; instrument panel

Fractures, posterior aspect of left ribs 6 and 7 with hemothorax	3	Unknown	—	—
Left pulmonary contusion	3	Unknown	—	—
Contusion, left shoulder	1	—	—	Shoulder belt
Fracture, left femoral neck	3	—	Knee bolster	—
Comminuted fracture, proximal aspect of the left tibia	3	—	Knee bolster	—
Comminuted fracture, proximal aspect of the left fibula	2	—	Knee bolster	—
Fracture, navicular bone of the left foot	2	—	Toepan	—
Fracture, intra-articular aspect of the first phalange of the left foot	1	—	Toepan	—
Contusions, left toes	1	—	Toepan	—
Open comminuted fracture, right calcaneous and partial disarticulation with the right subtalar joint and impingement of the right flexor hallucis longus tendon	2	—	Toepan	—
Maximum A.I.S. Level	3	—	—	—
Injury Severity Score	19	—	—	—

Occupant: Right front	Age: 49 years	Gender: Female		
Restraints: Three-point belt; dash-mounted airbag	Stature: 165 cm (5 ft, 5 in)	Mass: 67 kg (146 lb)		
Injury Description		A.I.S.	Injury Source	
—		—	Definite	Probable
—		—	Possible	
Abrasions, left side of nose	1	—	Airbag	—
Contusions, right and left lower abdomen	1	—	Lap belt	—
Abrasions, right and left hips	1	—	Lap belt	—
Displaced fracture, shaft of the left radius	3	—	Center instrument panel (bracing)	Airbag
Comminuted fracture, shaft of the left ulna	3	—	Center instrument panel (bracing)	Airbag
Contusion, lateral aspect of the left knee	1	—	Knee bolster/glove box	—
Contusion and abrasion, medial aspect of the right knee	1	—	Knee bolster/glove box	—
Fracture, right medial malleolus	2	—	Toepan	—
Comminuted fracture, cuboid bone of the right foot, extending into distal articular surface	2	—	Toepan	—
Fracture, navicular bone of the right foot	2	—	Toepan	—
Maximum A.I.S. Level	3	—	—	—
Injury Severity Score	10	—	—	—

CASE NO.: 367-03

CASE VEHICLE: 2002 Dodge


TYPE: Dakota Sport, 4 x 2, 4-door pickup

OCCUPANT: Driver: 61-year-old male

STATURE: 175 cm (5 ft, 9 in) MASS: 82 kg (180 lb)

RESTRAINTS: 3-point belt, steering-wheel airbag

SEVERITY: MAIS - 3 : ISS - 19

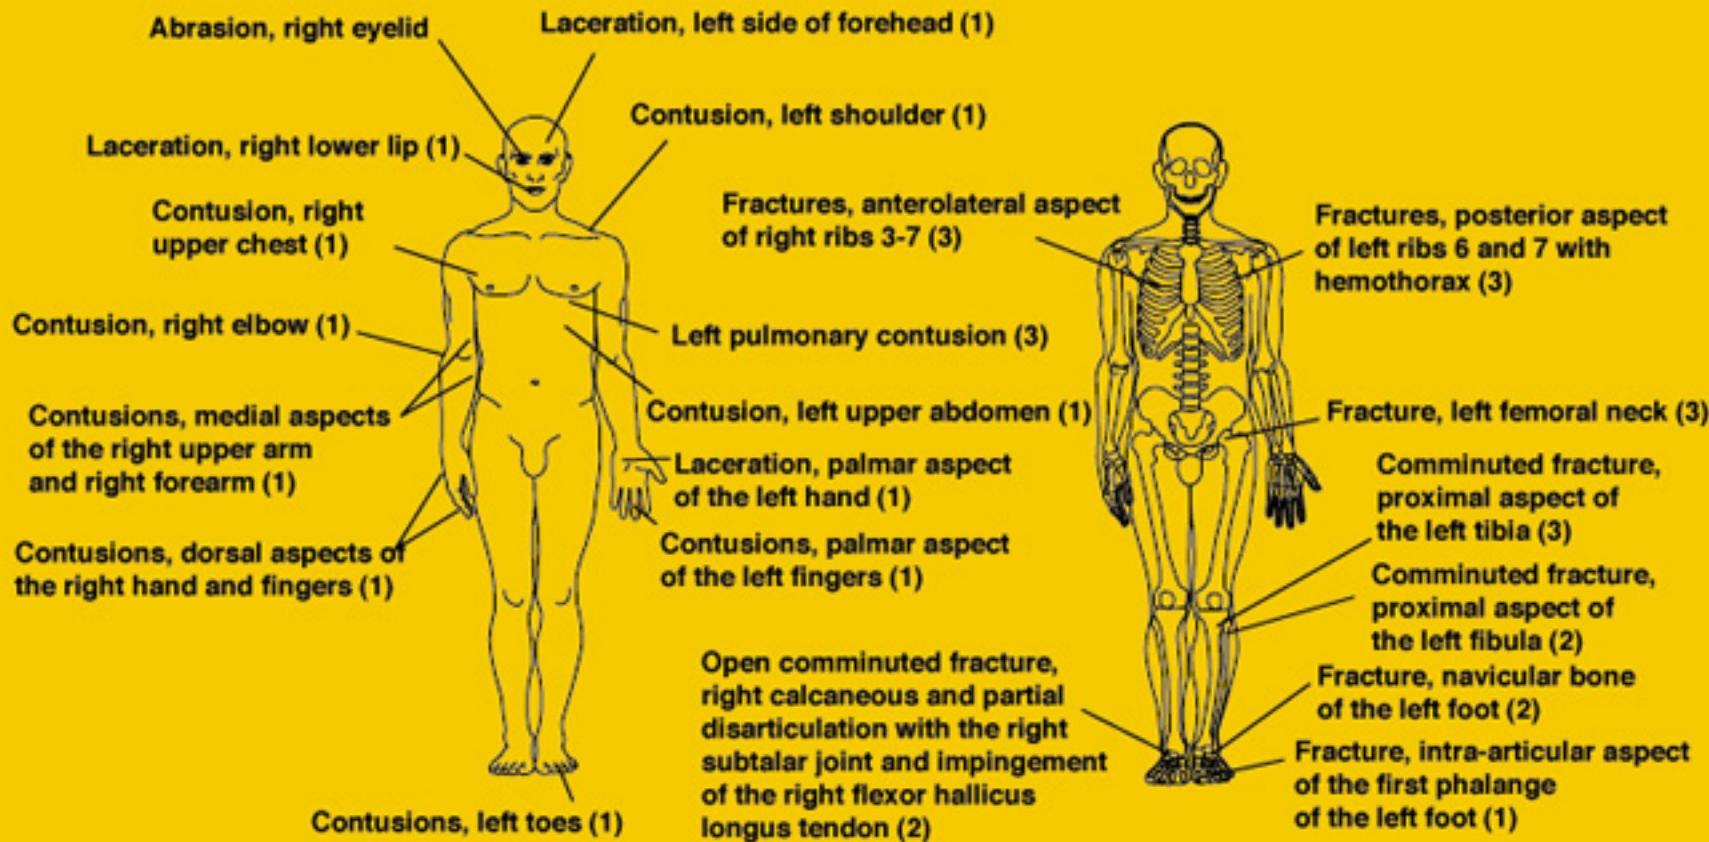

CASE NO.: 367-03

CASE VEHICLE: 2002 Dodge


TYPE: Dakota Sport, 4 x 2, 4-door pickup

OCCUPANT: Right front: 49-year-old female

STATURE: 165 cm (5 ft, 5 in) MASS: 66 kg (146 lb)

RESTRAINTS: 3-point belt, dash-mounted airbag

SEVERITY: MAIS - 3 ISS - 10

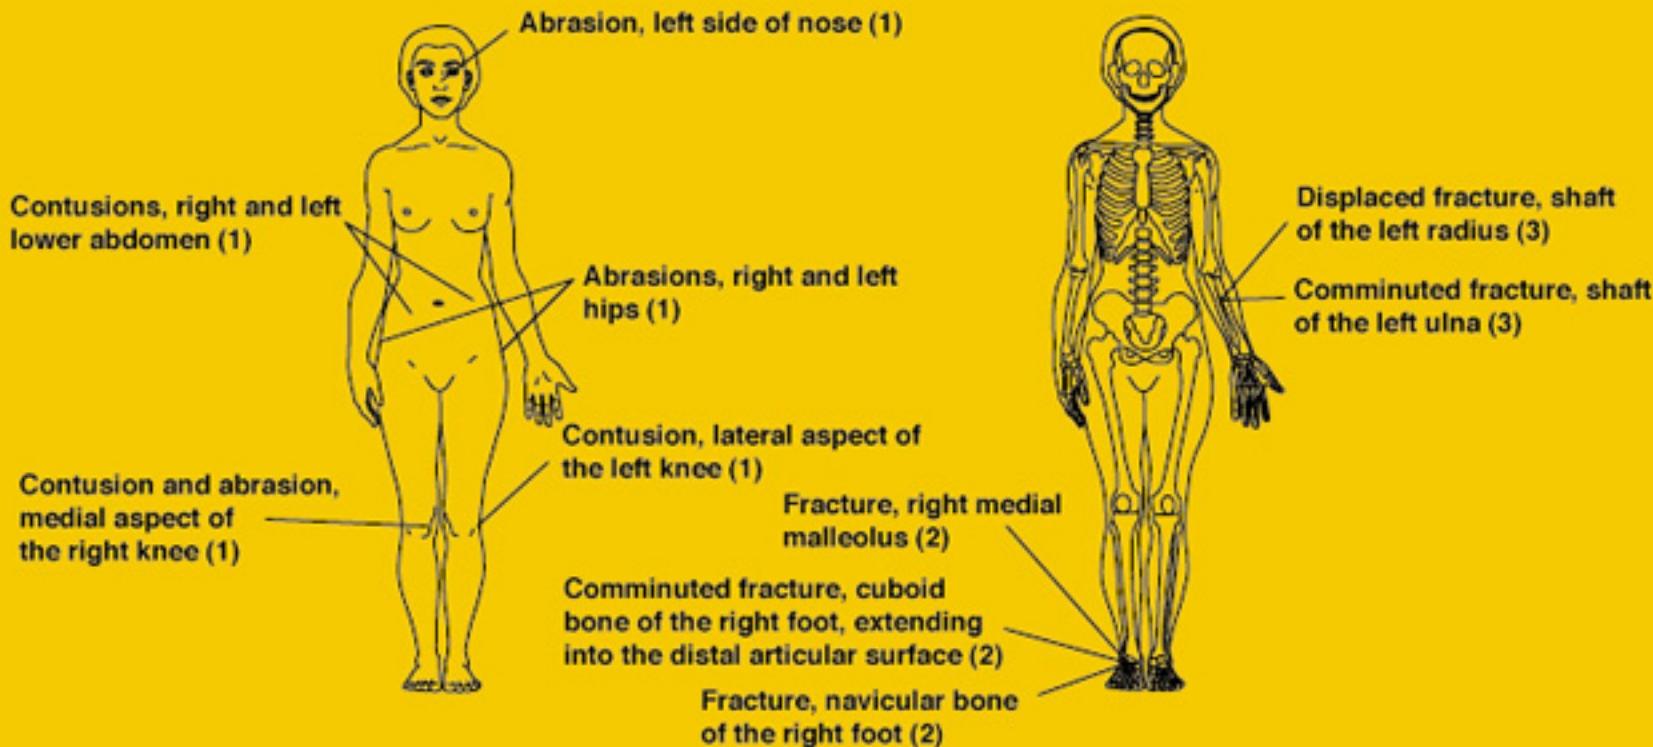

Case No.: 367-03

Case Veh. (A): 2002 Dodge

Type: Dakota Sport, 4 x 2, 4-door pickup

Driver: 61-year-old male

Veh. (B): 2002 Ford Explorer, 4 x 4, 4-door SUV

Light Conditions: Dark - unlighted

Weather: Snow

Road Surface: Snowy

Road Construction: Asphalt

North →

Shoulder



Shoulder

Speed limit 55 mph (89 kph)

Vehicle Report

General Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	more
V207 — Limited Access Highway	0	No	more
V208 — Road Total Lanes	2	2 lanes	more
V209 — Intersecting Road Total Lanes	8	Not applicable	more
V210 — Road Surface Type	1	Asphalt	more
V211 — Road Defects	0	No	more
V212 — Construction Zone	0	No	more
V213 — Road Alignment Vertical Plane	1	Level	more
V214 — Road Alignment Horizontal Plane	1	Straight	more
V215 — Surface Covering	31	Snow - loose	more
V216 — Visibility Limitation	0	None	more
V217 — Visibility Obstruction	0	None	more
V218 — Speed Limit	6	86-90 km/h .. 55 mph	more
V219 — Precipitation Type	2	Snow	more
V220 — Precipitation Rate	1	Light/mist	more
V221 — Temperature	2	-5 to -1 C .. 23 to 31 F	more
V222 — Crosswind	1	Light	more
V223 — Light Conditions	5	Dark, unlighted	more
V224 — Mechanical Malfunction Mention	0	No	more
V225 — Case Vehicle and Object	0	No	more

V226 — Case Vehicle Rollover	0	No	more
V227 — Case Vehicle Ran Off Roadway	0	No	more
V228 — Moving Case Vehicle/Contacted Moving Vehicle	1	Yes	more
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	more
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	more
V231 — Total Vehicles Hit By Case Vehicle	1	1 vehicle	more
V232 — Any Fire in Crash	0	No	more
V233 — Max Police Severity-PAR	3	A - Incapacitating Injury	more
V234 — Driver Alcohol Involvement	0	Had not been drinking	more
V235 — Driver Alcohol BAC	80	Not tested	more
V236 — Driver Impairment Mention	0	No	more
V237 — Driven/Towed From Scene	2	Towed Due to Damage	more

Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN	1FMZU72E72ZC	—	—
V302 — Other Vehicle Manufacturer/Body Code	12115	—	—
V303 — Other Vehicle Manufacturer	121	Ford	more
V304 — Other Vehicle Body Code	15	Long wheelbase utility vehicle (Carryall, Suburban)	more
V305 — Other Vehicle Make/Model	3131	Explorer MPV	more
V306 — Other Vehicle Model Year	2002	—	—
V307 — Other Vehicle Mass	001984 kg	—	—
V308 — Other Vehicle Number	1	Vehicle #1	more
V309 — Other Vehicle Number of Occupants	02	—	—
V310 — Other Vehicle Traveling Speed	999	Unknown	more
V311 — Highest Police Injury Severity	1	C - Possible Injury	more
V312 — Other Vehicle Type	15	Large utility (wheelbase >107", e.g. Suburban)	more
V313 — Other Vehicle Wheelbase (cm)	289 cm	—	—
V314 — Average Track Width	155 cm	—	—
V315 — Overall Length	481 cm	—	—
V316 — Overall Width (OAW)	183 cm	—	—
V317 — Front Overhang (FOH)	080 cm	—	—
V318 — Rear Overhang (ROH)	112 cm	—	—
V319 — Undeformed End Width (UEW)	154 cm	—	—
V320 — Engine Displacement	4.0 l	—	—

V321 — Engine: Number of Cylinders	06	—	—
V322 — Direct Damage Length (DDL)	154 cm	—	—
V323 — Front-End Overlap % (FEO)	98	98% or more	more
V324 — Vehicle Overlap % (VOL)	98	98% or more	more

Case Vehicle

General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	1B7HL38X92S6	—	—
V402 — Manufacturer/Body Code	13212	—	—
V403 — Vehicle Manufacturer	132	Dodge	more
V404 — Vehicle Body Code	12	—	—
V405 — Make/Model Code	3225	Dakota PU	more
V406 — Model Year	2002	—	—
V407 — Vehicle Mass	001926 kg	—	—
V408 — Odometer Reading	888888	—	—
V409 — Number of Occupants	02	—	—
V410 — Traveling Speed	999	Unknown	more
V411 — Body Type	33	Pickup truck (large)	more
V412 — Stolen Vehicle	8	Not currently collected	more
V413 — Body Structure	1	Body and frame	more
V414 — Transmission Type	1	Automatic	more
V415 — Transmission Lever Location	2	Console	more
V416 — Steering	1	Power	more
V417 — Brakes	1	Power	more
V418 — Brake Type	2	Disc - front wheels	more
V419 — Brake Anti-lock Device	2	Four-wheel	more
V420 — Air Conditioning in Vehicle	8	Not currently collected	more
V421 — Drive Type	1	Rear wheel	more
V422 — Dual Rear Wheels	0	No	more
V423 — Original Restraint System Type	3	Airbag	more

V424 — Equipped With Roll Bar	0	No	more
V425 — Roof Type	1	Solid	more
V426 — Wheelbase	333 cm	—	—
V427 — Anti-lacerative Glass	0	None	more
V428 — Average Track Width	158 cm	—	—
V429 — Overall Length	546 cm	—	—
V430 — Overall Width (OAW)	182 cm	—	—
V431 — Front Overhang	087 cm	—	—
V432 — Rear Overhang	126 cm	—	—
V433 — Undeformed End Width (UEW)	162 cm	—	—
V434 — Engine Displacement	3.9 l	—	—
V435 — Engine: Number of Cylinders	06	—	—
V436 — Direct Damage Length (DDL)	095 cm	—	—
V437 — Front End Overlap % (FEO)	59	—	—
V438 — Vehicle Overlap % (VOL)	58	—	—

Case Vehicle

Damage

Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	079 cm	—	—
V502 — Maximum Crush - Right Side	000 cm	No crush (or less than 1 cm.)	more
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	more
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	more
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	more
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	more
V507 — Are Events In Chronological Order	1	Yes	more
V508 — Event 1 Impact Location	1	On Roadway	more
V509 — Event 1 Impact Configuration	11	FRONT of case veh - FRONT of contacted Vehicle	more
V510 — Event 1 Object/Vehicle Contacted	15	Large utility (wheelbase >107", e.g. Suburban)	more
V511 — Event 2 Impact Location	8	No 2nd event	more
V512 — Event 2 Impact Configuration	88	No 2nd event	more
V513 — Event 2 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V514 — Event 3 Impact Location	8	No 3rd event	more
V515 — Event 3 Impact Configuration	88	No 3rd event	more
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V517 — Event 4 Impact Location	8	No 4th event	more
V518 — Event 4 Impact Configuration	88	No 4th event	more

V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V520 — Event 5 Impact Location	8	No 5th event	more
V521 — Event 5 Impact Configuration	88	No 5th event	more
V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V523 — Event 6 Impact Location	8	No 6th event	more
V524 — Event 6 Impact Configuration	88	No 6th event	more
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V526 — Event 7 Impact On Road	8	No 7th event	more
V527 — Event 7 Impact Configuration	88	No 7th event	more
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V529 — Primary CDC Case Vehicle -event Number	1	Event 1	more
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	more
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	more
V532 — Primary CDC Case Vehicle -crush	079	—	—
V533 — Primary CDC Case Vehicle -clock #1	12	12 o'clock	more
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	more
V535 — Primary CDC Case Vehicle letter 2 #1	25	Y - Side or end (F + P or L + C)	more
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	more
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	more
V538 — Primary CDC Case Vehicle Extent #1	04	Extent 4	more
V539 — Primary CDC Case Vehicle -CDC #1	12FYEW4	—	—

V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	999	Unknown	more
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	more
V549 — Primary CDC Contacted Vehicle -crush	063	—	—
V550 — Primary CDC Contacted Vehicle -clock #1	01	1 o'clock	more
V551 — Primary CDC Contacted Vehicle letter 1 #1	06	F - Front	more
V552 — Primary CDC Contacted Vehicle letter 2 #1	04	D - Distributed (Side or End) or (F + P + B)	more
V553 — Primary CDC Contacted Vehicle letter 3 #1	05	E - Everything below belt line	more
V554 — Primary CDC Contacted Vehicle letter 4 #1	23	W - Wide impact area	more
V555 — Primary CDC Contacted Vehicle Extent #1	03	Extent 3	more
V556 — Primary CDC Contacted Vehicle -CDC #1	01FDEW3	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more

V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V563 — Primary CDC Contacted Vehicle -CDC #2	9800000	—	—
V564 — Secondary CDC Case Vehicle - Event No	8	Not applicable	more
V565 — Secondary CDC Case Vehicle - Impact Speed	998	Not Applicable	more
V566 — Secondary CDC Case Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	more
V567 — Secondary CDC Case Vehicle -crush	998	Not Applicable	more
V568 — Secondary CDC Case Vehicle -clock #1	98	Not Applicable	more
V569 — Secondary CDC Case Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V570 — Secondary CDC Case Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V571 — Secondary CDC Case Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V572 — Secondary CDC Case Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V573 — Secondary CDC Case Vehicle Extent #1	00	Missing Data/Not applicable	more
V574 — Secondary CDC Case Vehicle -CDC #1	9800000	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	more

V583 — Secondary CDC Contacted Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	more
V584 — Secondary CDC Contacted Vehicle -crush	998	Not Applicable	more
V585 — Secondary CDC Contacted Vehicle -clock #1	98	Not Applicable	more
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	more
V591 — Secondary CDC Contacted Vehicle -CDC #1	9800000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V598 — Secondary CDC Contacted Vehicle -CDC #2	9800000	—	—

Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	045 kph	—	—
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-044 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	0008 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	0221 kJ	—	—
V606 — Primary Impact Case Vehicle -reconstruction	22	Reconstructed, moderate confidence level	more
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	045 kph	—	—
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	-039 kph	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	-022 kph	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	0180 kJ	—	—
V612 — Case Vehicle Secondary Impact Number	8	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	888	N/A	more
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	8888	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	8888	—	—
V617 — Secondary Case Vehicle Reconstruction Note	88	—	—

V618 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	more
V619 — Secondary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	more
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	052 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-051 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0009 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0221 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	more
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V630 — Primary Contacted Vehicle Reconstruction Total EBS	039 kph	—	—
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	-034 kph	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	-019 kph	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	0180 kJ	—	—
V634 — Case Vehicle Secondary Impact Number	8	Not applicable	more
V635 — Secondary Case Vehicle Reconstruction Total EBS	888	N/A	more
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	8888	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	8888	—	—

V638 — Secondary Case Vehicle Reconstruction Crush Energy	8888	—	—
V639 — Secondary Case Vehicle Reconstruction Note	88	—	—
V640 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	more
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	more
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	more
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	095 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	079 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	092 cm	—	—
V650 — Case Vehicle Impact 1 C1	079 cm	—	—
V651 — Case Vehicle Impact 1 C2	072 cm	—	—
V652 — Case Vehicle Impact 1 C3	063 cm	—	—
V653 — Case Vehicle Impact 1 C4	050 cm	—	—
V654 — Case Vehicle Impact 1 C5	006 cm	—	—
V655 — Case Vehicle Impact 1 C6	000 cm	No Crush	more
V656 — Case Vehicle Impact 1 +/- D	-034 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	1	—	—
V658 — Case Vehicle Impact 2 Plane	1	Bumper	more
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	154 cm	—	—
V660 — Case Vehicle Impact 2 Max	063 cm	—	—

Crush			
V661 — Case Vehicle Impact 2 Field-L	103 cm	—	—
V662 — Case Vehicle Impact 2 C1	030 cm	—	—
V663 — Case Vehicle Impact 2 C2	027 cm	—	—
V664 — Case Vehicle Impact 2 C3	046 cm	—	—
V665 — Case Vehicle Impact 2 C4	063 cm	—	—
V666 — Case Vehicle Impact 2 C5	051 cm	—	—
V667 — Case Vehicle Impact 2 C6	021 cm	—	—
V668 — Case Vehicle Impact 2 +/- D	0000 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	2	—	—
V670 — Other Vehicle Impact 1 Plane	8	Not applicable	more
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	998	Not applicable	more
V672 — Other Vehicle Impact 1 Max Crush	998	Not applicable	more
V673 — Other Vehicle Impact 1 Field-L	998	Not applicable	more
V674 — Other Vehicle Impact 1 C1	998	Not applicable	more
V675 — Other Vehicle Impact 1 C2	998	Not applicable	more
V676 — Other Vehicle Impact 1 C3	998	Not applicable	more
V677 — Other Vehicle Impact 1 C4	998	Not applicable	more
V678 — Other Vehicle Impact 1 C5	998	Not applicable	more
V679 — Other Vehicle Impact 1 C6	998	Not applicable	more
V680 — Other Vehicle Impact 1 +/- D	9998	—	—
V681 — Other Vehicle Reconstructed Impact Number	2	—	—
V682 — Other Vehicle Impact 2 Plane	8	Not applicable	more
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	998	Not applicable	more
V684 — Other Vehicle Impact 2 Max Crush	998	Not applicable	more

V685 — Other Vehicle Impact 2 Field-L	998	Not applicable	more
V686 — Other Vehicle Impact 2 C1	998	Not applicable	more
V687 — Other Vehicle Impact 2 C2	998	Not applicable	more
V688 — Other Vehicle Impact 2 C3	998	Not applicable	more
V689 — Other Vehicle Impact 2 C4	998	Not applicable	more
V690 — Other Vehicle Impact 2 C5	998	Not applicable	more
V691 — Other Vehicle Impact 2 C6	998	Not applicable	more
V692 — Other Vehicle Impact 2 +/- D	9998	—	—

Case Vehicle

Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	1	Yes	more
V702 — Right Front Wheel Damaged	0	No	more
V703 — Right Rear Wheel Damaged	0	No	more
V704 — Left Rear Wheel Damaged	0	No	more
V705 — Left Front Tire Tread Type	4	All Weather	more
V706 — Right Front Tire Tread Type	4	All Weather	more
V707 — Right Rear Tire Tread Type	4	All Weather	more
V708 — Left Rear Tire Tread Type	4	All Weather	more
V709 — Left Front Carcass Construction	3	Radial	more
V710 — Right Front Carcass Construction	3	Radial	more
V711 — Right Rear Carcass Construction	3	Radial	more
V712 — Left Rear Carcass Construction	3	Radial	more
V717 — Left Front Tire Size	P25565R16	—	—
V718 — Right Front Tire Size	P25565R16	—	—
V719 — Right Rear Tire Size	P25565R16	—	—
V720 — Left Rear Tire Size	P25565R16	—	—

Case Vehicle

Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	more
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	more
V803 — Main Filler Cap Location	313	Left of frame laterally - above vertically	more
V804 — Main Tank Material	1	Steel	more
V805 — Aux Tank Type	8	Not applicable (not equipped)	more
V806 — Aux Tank Location	888	Not applicable (not equipped)	more
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	more
V808 — Aux Tank Material	8	Not applicable	more
V901 — Fuel Leakage From Crash	0	No	more
V1001 — Fire In Or On Case Vehicle	0	No	more

Case Vehicle

Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	more
V1102 — Hood Latch Damaged	1	Yes	more
V1103 — Hood Latch Jammed	1	Yes	more
V1104 — Left Hood Hinge Damaged	1	Yes	more
V1105 — Left Hood Hinge Separated	0	No	more
V1106 — Right Hood Hinge Damaged	1	Yes	more
V1107 — Right Hood Hinge Separated	0	No	more
V1108 — Hood Remained On Vehicle	1	Yes	more
V1109 — Rear Hood Edge Elevated	1	Yes	more
V1110 — Edge Contacted Windshield	1	Yes	more
V1111 — Edge Penetrated Windshield	0	No	more
V1112 — Hood Latch Location	1	Front of Vehicle	more
V1113 — Eng/Transmissn Mount Separation	0	No	more
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	more
V1115 — Steerng Column Coupling Damaged	9	Unknown	more
V1116 — Steerng Column Coupling Separated	9	Unknown	more
V1117 — Eng Comp Telescopng Unit	88	Not collected	more
V1118 — Comp Orig/Telescopd Diff	888	Not collected	more

V1119 — Left Side Body Mount Separation	0	No	more
V1120 — Upper Left A-pillar Separation	4	No separation, but damaged	more
V1121 — Lower Left A-pillar Separation	4	No separation, but damaged	more
V1122 — Upper Left B-pillar Separation	4	No separation, but damaged	more
V1123 — Lower Left B-pillar Separation	4	No separation, but damaged	more
V1124 — Upper Left C-pillar Separation	0	No	more
V1125 — Lower Left C-pillar Separation	0	No	more
V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	more
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	more
V1128 — Left Front Door Opening Cause	0	Door did not open	more
V1129 — Left Rear Door Opening Cause	0	Door did not open	more
V1130 — Left Front Door Jammed Closed	1	Yes	more
V1131 — Left Rear Door Jammed Closed	0	No	more
V1132 — Rear Door Type	0	No door (includes pickups)	more
V1133 — Rear Door Opening Cause	8	Not applicable (no rear door)	more
V1134 — Rear Door Jammed Closed	8	Not applicable (no rear door)	more
V1135 — Luggage Partition Damaged	8	Not applicable	more
V1136 — Spare Tire Status	8	Not collected	more
V1137 — Trailer Hitch Type	3	Bumper and frame (but non-equalizing)	more
V1138 — Trailer Type	0	No trailer	more
V1139 — Right Side Body Mount Separation	0	No	more

V1140 — Upper Right A-pillar Separation	0	No	more
V1141 — Lower Right A-pillar Separation	0	No	more
V1142 — Upper Right B-pillar Separation	0	No	more
V1143 — Lower Right B-pillar Separation	0	No	more
V1144 — Upper Right C-pillar Separation	0	No	more
V1145 — Lower Right C-pillar Separation	0	No	more
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	more
V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	more
V1148 — Right Front Door Opening Cause	00	Door did not open	more
V1149 — Right Rear Door Opening Cause	00	Door did not open	more
V1150 — Right Front Door Jammed Closed	0	No	more
V1151 — Right Rear Door Jammed Closed	0	No	more
V1152 — Van Rear Door Type	8	Not applicable (not a van)	more
V1153 — Windshield Cracked		Yes	more
V1154 — Windshield Broken	0	No	more
V1155 — Windshield Cracked or Broken by Occupant	0	No	more
V1156 — Bond Separation Extent	0	None	more
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	more

Case Vehicle

Steering

Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	2	Severely bent	more
V1202 — Number of Steering Wheel Spokes	4	4 spokes	more
V1203 — Steering Wheel Spoke Damage	2	Severely bent	more
V1204 — Column Tilt Feature	2	Up	more
V1205 — Column Swing-away Feature	0	Not equipped	more
V1206 — Column Telescoping Feature	0	Not equipped	more
V1207 — Wheel Energy Absorb Device	8	Not collected	more
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	more
V1209 — Column Energy Absorb Device	88	Not collected	more
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	more
V1211 — Shear Capsule Separation	888	Not collected	more
V1212 — Column Vertical Rotation	1	Upward apparent rotation	more
V1213 — Column Lateral Rotation	2	Right apparent rotation	more
V1214 — Steering Wheel Hub Damage	1	Occupant contact	more

Case Vehicle

Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	1	Yes	more
V1302 — Was Intrusion Catastrophic	0	No	more
V1303 — Intrusion Number 01	01	Intrusion #1	more
V1304 — Intrusion 01 Occupant Space Number	11	First row, Left seat	more
V1305 — Intrusion 01 Intruding Object	03	Toe pan	more
V1306 — Intrusion 01 Assoc Event Number	1	Event #1	more
V1307 — Intrusion 01 Max Intrusion X-axis	39 cm	—	—
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1310 — Intrusion 01 Occupant Number	01	Occupant number 1, contact	more
V1311 — Intrusion 01 Injury Number	19	—	—
V1312 — Intrusion 01 Occupant Number	01	Occupant number 1, contact	more
V1313 — Intrusion 01 Injury Number	22	Injury #22	more
V1314 — Intrusion Number 02	02	Intrusion #2	more
V1315 — Intrusion 02 Occupant Space Number	11	First row, Left seat	more
V1316 — Intrusion 02 Intruding Object	01	Instrument panel	more
V1317 — Intrusion 02 Assoc Event Number	1	Event #1	more

V1318 — Intrusion 02 Max Intrusion X-axis	36 cm	—	—
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1321 — Intrusion 02 Occupant Number	01	Occupant number 1, contact	more
V1322 — Intrusion 02 Injury Number	16	Injury #16	more
V1323 — Intrusion 02 Occupant Number	01	Occupant number 1, contact	more
V1324 — Intrusion 02 Injury Number	17	Injury #17	more
V1325 — Intrusion Number 03	03	Intrusion #3	more
V1326 — Intrusion 03 Occupant Space Number	11	First row, Left seat	more
V1327 — Intrusion 03 Intruding Object	29	Side footwell panel (kickpanel)	more
V1328 — Intrusion 03 Assoc Event Number	1	Event #1	more
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1330 — Intrusion 03 Max Intrusion Y-axis	27 cm	—	—
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1332 — Intrusion 03 Occupant Number	00	No contact or no intrusion	more
V1333 — Intrusion 03 Injury Number	00	No injury or no intrusion	more
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	more
V1335 — Intrusion 03 Injury Number	00	No injury or no intrusion	more
V1336 — Intrusion Number 04	04	Intrusion #4	more
V1337 — Intrusion 04 Occupant Space Number	11	First row, Left seat	more
V1338 — Intrusion 04 Intruding	05	Steering column	more

Object			
V1339 — Intrusion 04 Assoc Event Number	1	Event #1	more
V1340 — Intrusion 04 Max Intrusion X-axis	24 cm	—	—
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1343 — Intrusion 04 Occupant Number	01	Occupant number 1, contact	more
V1344 — Intrusion 04 Injury Number	11	Injury #11	more
V1345 — Intrusion 04 Occupant Number	01	Occupant number 1, contact	more
V1346 — Intrusion 04 Injury Number	12	Injury #12	more
V1347 — Intrusion Number 05	05	Intrusion #5	more
V1348 — Intrusion 05 Occupant Space Number	11	First row, Left seat	more
V1349 — Intrusion 05 Intruding Object	07	Windshield header	more
V1350 — Intrusion 05 Assoc Event Number	1	Event #1	more
V1351 — Intrusion 05 Max Intrusion X-axis	08 cm	—	—
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	more
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	more
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	more
V1357 — Intrusion 05 Injury Number	00	No injury or no intrusion	more
V1358 — Intrusion Number 06	06	Intrusion #6	more

V1359 — Intrusion 06 Occupant Space Number	11	First row, Left seat	more
V1360 — Intrusion 06 Intruding Object	14	Roof side rails	more
V1361 — Intrusion 06 Assoc Event Number	1	Event #1	more
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1363 — Intrusion 06 Max Intrusion Y-axis	05 cm	—	—
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1368 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1369 — Intrusion Number 07	07	Intrusion #7	more
V1370 — Intrusion 07 Occupant Space Number	13	First row, Right seat	more
V1371 — Intrusion 07 Intruding Object	03	Toe pan	more
V1372 — Intrusion 07 Assoc Event Number	1	Event #1	more
V1373 — Intrusion 07 Max Intrusion X-axis	16 cm	—	—
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1376 — Intrusion 07 Occupant Number	01	Occupant number 1, contact	more
V1377 — Intrusion 07 Injury Number	11	—	—
V1378 — Intrusion 07 Occupant Number	01	Occupant number 1, contact	more

V1379 — Intrusion 07 Injury Number	12	—	—
V1380 — Intrusion Number 08	08	Intrusion #8	more
V1381 — Intrusion 08 Occupant Space Number	13	First row, Right seat	more
V1382 — Intrusion 08 Intruding Object	01	Instrument panel	more
V1383 — Intrusion 08 Assoc Event Number	1	Event #1	more
V1384 — Intrusion 08 Max Intrusion X-axis	09 cm	—	—
V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	more
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	more
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	more
V1390 — Intrusion 08 Injury Number	00	No injury or no intrusion	more
V1391 — Intrusion Number 09	00	No Intrusion, None	more
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	more
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	more
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	more
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1399 — Intrusion 09 Injury	00	No injury or no intrusion	more

Number			
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	more
V1402 — Intrusion Number 10	00	No Intrusion, None	more
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	more
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	more
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	more
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	more
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	more
V1413 — Door Intrusion Number 01	88	Not Applicable	more
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	more
V1415 — Door Intrusion Number 02	88	Not Applicable	more
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	more
V1417 — Door Intrusion Number 03	88	Not Applicable	more
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	more
V1419 — Door Intrusion 01	88	Not Applicable	more

Component			
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	more
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	more
V1422 — Door Intrusion 02 Component	88	Not Applicable	more
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	more
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	more
V1425 — Door Intrusion 03 Component	88	Not Applicable	more
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	more
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	more
V1428 — Door Intrusion 04 Component	88	Not Applicable	more
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	more
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	more

Case Vehicle

Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	more
V1502 — Driver Airbag Deployed	1	Yes	more
V1503 — Driver Airbag Condition	0	No Damage	more
V1504 — Passenger Airbag Equip	1	Yes	more
V1505 — Passenger Airbag Deployed	1	Yes	more
V1506 — Passenger Airbag Condition	0	No Damage	more
V1507 — Steering Wheel Airbag Tether	1	Yes	more
V1508 — Driver Airbag Marked By Contact	1	Yes	more
V1509 — Passenger Airbag Tether	1	Yes	more
V1510 — Passenger Airbag Marked By Contact	0	No	more

Case Vehicle

Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	4	Yes, occupant contact	more
V1602 — Right Front Door Damaged	0	No	more
V1603 — Left Front Hardware Damaged	4	Yes, occupant contact	more
V1604 — Right Front Hardware Damaged	0	No	more
V1605 — Left Front Armrest Damaged	4	Yes, occupant contact	more
V1606 — Right Front Armrest Damaged	0	No	more
V1607 — Left Front Glass Damaged	1	Yes	more
V1608 — Right Front Glass Damaged	0	No	more
V1609 — Left Rear Door Area Damaged	0	No	more
V1610 — Right Rear Door Area Damaged	0	No	more
V1611 — Left Rear Hardware Damaged	0	No	more
V1612 — Right Rear Hardware Damaged	0	No	more
V1613 — Left Rear Armrest Damaged	0	No	more
V1614 — Right Rear Armrest Damaged	0	No	more
V1615 — Left Rear Glass Damaged	0	No	more
V1616 — Right Rear Glass Damaged	0	No	more
V1617 — Left Roof Side Rail Damaged	0	No	more

V1618 — Right Roof Side Rail Damaged	0	No	more
V1619 — Left B-pillar Damaged	0	No	more
V1620 — Right B-pillar Damaged	0	No	more
V1621 — Left C-pillar Damaged	0	No	more
V1622 — Right C-pillar Damaged	0	No	more
V1623 — Left D-pillar Damaged	8	Not applicable	more
V1624 — Right D-pillar Damaged	8	Not applicable	more
V1625 — Left Headlining Damaged	1	Yes	more
V1626 — Right Headlining Damaged	1	Yes	more
V1627 — Left Roof Structure Damaged	1	Yes	more
V1628 — Right Roof Structure Damaged	1	Yes	more
V1629 — Left T/Sun Roof Damaged	8	Not applicable	more
V1630 — Right T/Sun Roof Damaged	8	Not applicable	more
V1631 — Other Left Side Item Damaged	8	Not applicable	more
V1632 — Other Right Side Item Damaged	8	Not applicable	more
V1633 — Foot Controls Damaged	4	Yes, occupant contact	more
V1634 — Ignition Key Damaged	1	Yes	more
V1635 — Rear View Mirror Damaged	0	No	more
V1636 — Sunvisor/Fitting Damaged	0	No	more
V1637 — Windshield Molding Damaged	1	Yes	more
V1638 — Left A-pillar Damaged	1	Yes	more
V1639 — Right A-pillar Damaged	0	No	more
V1640 — Center Console Damaged	8	Not applicable	more

V1641 — Transmission Lever Damaged	1	Yes	more
V1642 — Horn/Spoke Shroud Damaged	4	Yes, occupant contact	more
V1643 — Upper Panel Damaged	4	Yes, occupant contact	more
V1644 — Mid Panel Damaged	4	Yes, occupant contact	more
V1645 — Lower Panel Damaged	4	Yes, occupant contact	more
V1646 — Ashtray Damaged	1	Yes	more
V1647 — Control Knob/Lever Damaged	1	Yes	more
V1648 — Glove Compartment Area Damaged	4	Yes, occupant contact	more
V1649 — Instruments Damaged	1	Yes	more
V1650 — Park Brake Release Damaged	1	Yes	more
V1651 — Park Brake Pedal Damaged	0	No	more
V1652 — A/C Or Upper Vent Damaged	1	Yes	more
V1653 — Heater Or A/C Duct Damaged	1	Yes	more
V1654 — Radio Damaged	1	Yes	more
V1655 — Other Item Damaged	8	Not applicable	more
V1656 — Rear Window Damaged	0	No	more
V1657 — Rear Window Header Damaged	0	No	more
V1658 — Vertical Console Damaged	4	Yes, occupant contact	more
V1659 — Roof Console Damaged	1	Yes	more

Case Vehicle




Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	97	Other	more
V1702 — Passenger Front Seat Type	97	Other	more
V1703 — Driver Seat Mount Type	1	Standard	more
V1704 — Passenger Seat Mount Type	1	Standard	more
V1705 — Driver Swivel Mechanism Equipped	0	No	more
V1706 — Passenger Swivel Mechanism Equipped	0	No	more
V1707 — Driver Seat Original Equipment	1	Yes	more
V1708 — Passenger Seat Original Equipment	1	Yes	more
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	more
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	more
V1711 — Driver Seat Damage	1	Backrest only damaged	more
V1712 — Passenger Seat Damage	0	None	more
V1713 — Center Front Armrest Damaged	0	No	more
V1714 — Driver Seat Rotation	3	Left apparent	more
V1715 — Passenger Seat Rotation	0	None apparent	more
V1716 — Driver Seat-back Type	3	Reclining	more
V1717 — Passenger Seat-back Type	3	Reclining	more
V1718 — Driver Seat-back Lock Type	1	Manual	more
V1719 — Passenger Seat-back Lock Type	1	Manual	more
V1720 — Driver Seat-back Lock Held	1	Yes	more

V1721 — Passenger Seat-back Lock Held	1	Yes	more
V1722 — Driver Recliner Mechanism Held	1	Yes	more
V1723 — Passenger Recliner Mechanism Held	1	Yes	more
V1724 — Driver Head Restraint Type	2	Integral	more
V1725 — Passenger Head Restraint Type	2	Integral	more
V1726 — Driver Head Rest Removed	8	Not applicable	more
V1727 — Passenger Head Rest Removed	8	Not applicable	more
V1728 — Driver Head Rest Adjustment	8	Not applicable	more
V1729 — Passenger Head Rest Adjustment	8	Not applicable	more
V1730 — Driver Head Rest Damage	0	None	more
V1731 — Passenger Head Rest Damage	0	None	more
V1732 — Driver Seat Adjustment Type	1	Manual	more
V1733 — Passenger Seat Adjustment Type	1	Manual	more
V1734 — Driver Seat Adjustment Provided	1	2-way	more
V1735 — Passenger Seat Adjustment Provided	1	2-way	more
V1736 — Driver Seat Adjuster Damage	2	Deformed (released/jammed)	more
V1737 — Passenger Seat Adjuster Damage	0	None	more
V1738 — Driver Seat Adjuster Separation	0	None	more
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	more
V1740 — Driver Seat Pre-crash Position	2	Middle	more
V1741 — Passenger Seat Pre-crash Position	2	Middle	more
V1742 — Left Rear Seat Type	2	Folding	more
V1743 — Right Rear Seat Type	2	Folding	more

V1744 — Left Rear Seat Damaged	0	None	more
V1745 — Right Rear Seat Damaged	0	None	more
V1746 — Center Rear Armrest Damaged	8	Not applicable (No Center Armrest)	more
V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	more
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	more
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	more
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	more
V1751 — Left Rear Seat-back Right Lock Equipped	0	No	more
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	more
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	more
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	more
V1755 — Left 3rd Seat Equipped	0	No	more
V1756 — Right 3rd Seat Equipped	0	No	more
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	more
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	more
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	more
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	more
V1761 — Rear Head Restraints	1	Equipped	more



MEASUREMENTS IN CENTIMETERS

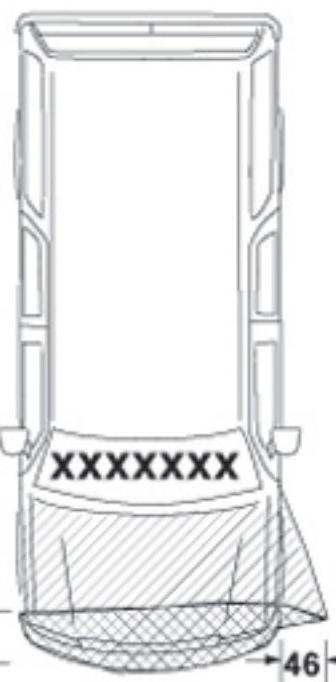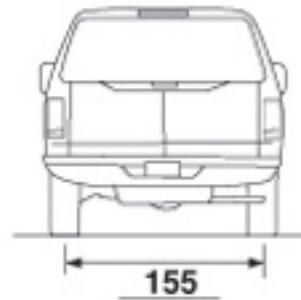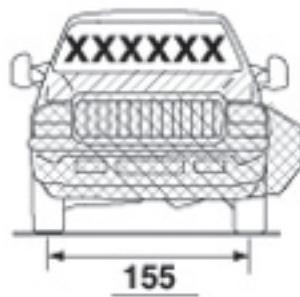

Max. crush to
center front—
bumper

63

Left fender
deflected to
left

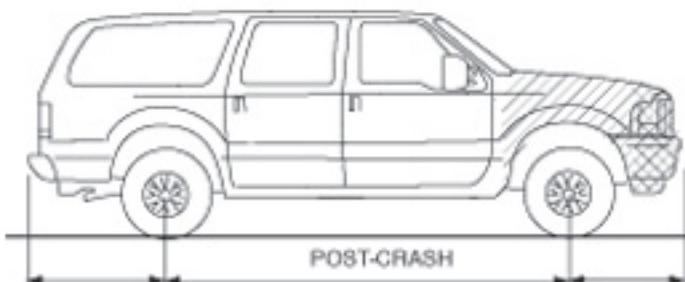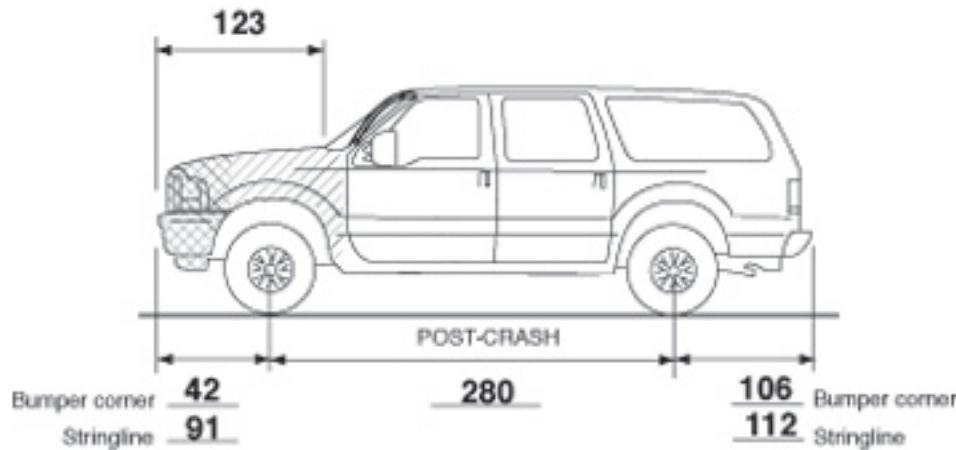

Bumper corner
Stringline


106
112

POST-CRASH


45
85

Bumper corner
Stringline


MEASUREMENTS IN CENTIMETERS

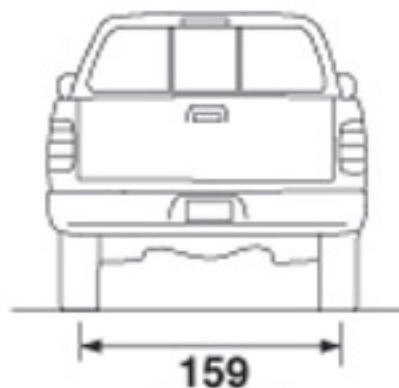


**Width of direct damage
to front**

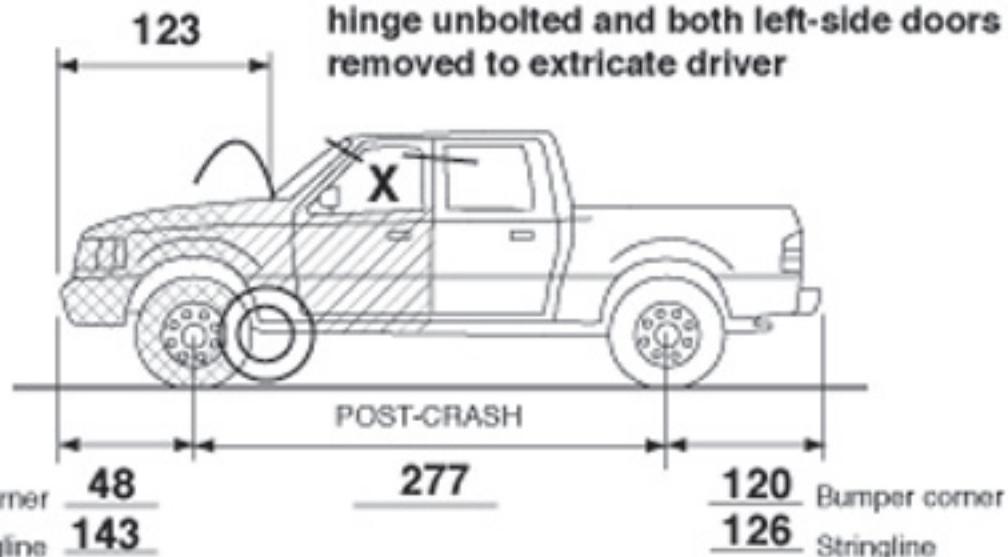


**Max. crush to left-front
bumper corner**

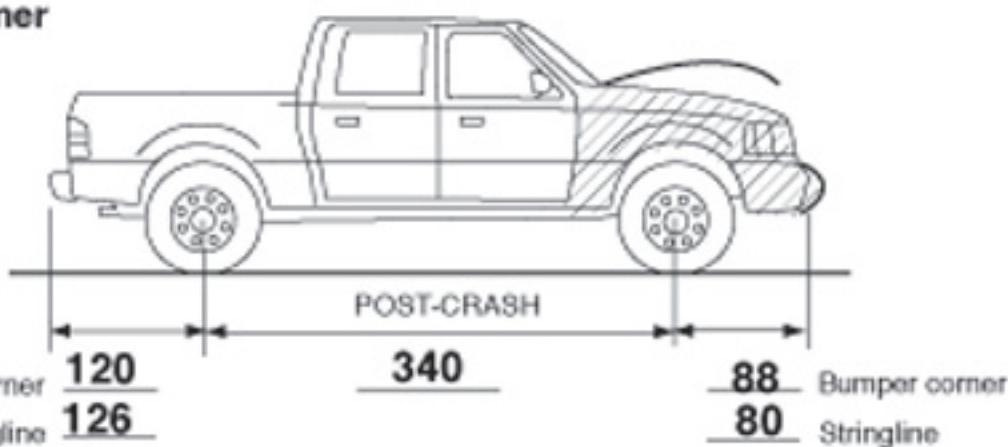

WINDSHIELD MARK ON CASE VEHICLE:

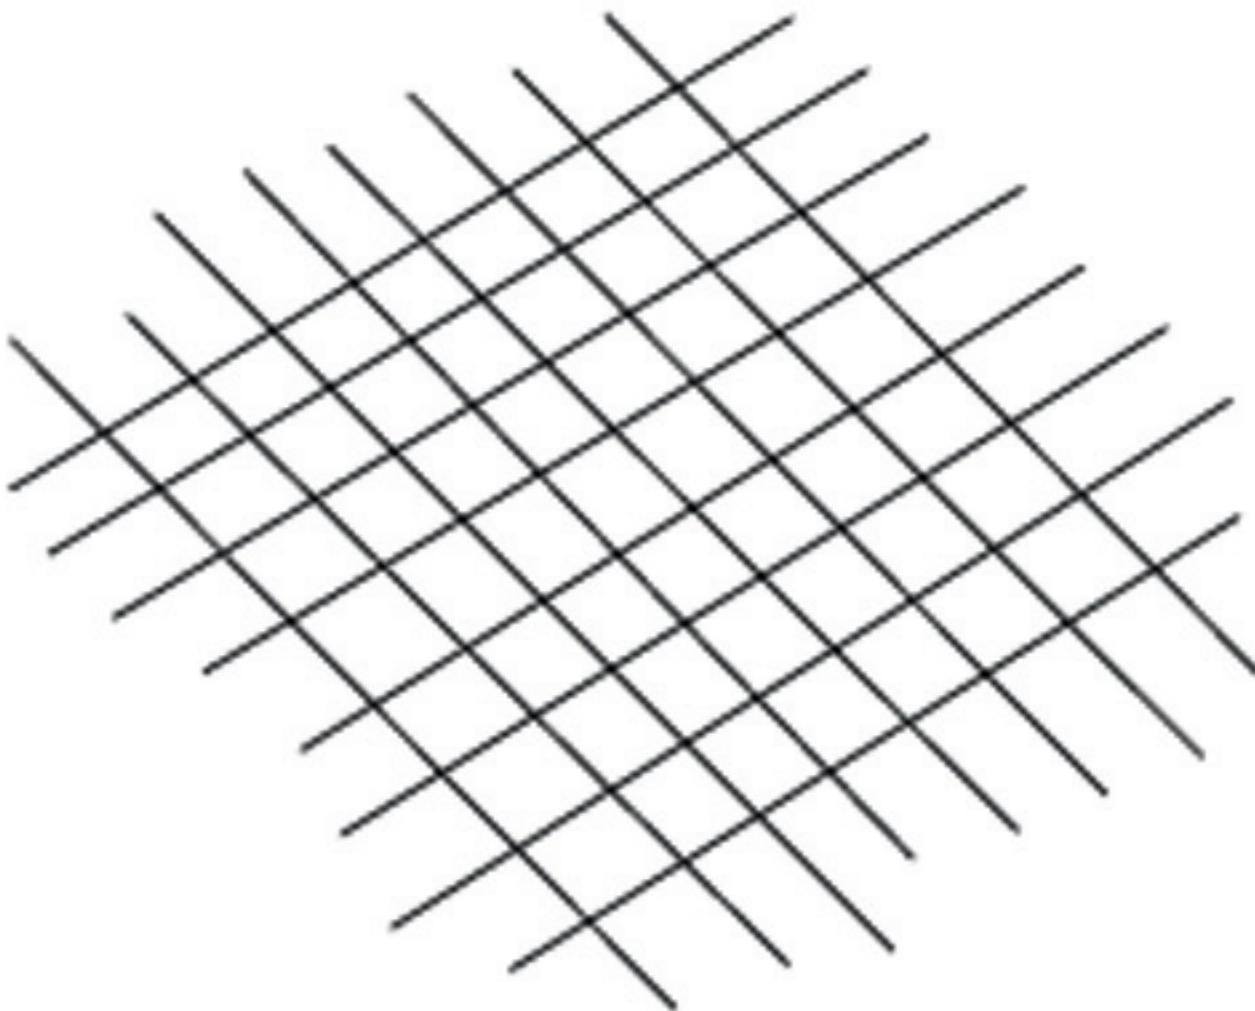

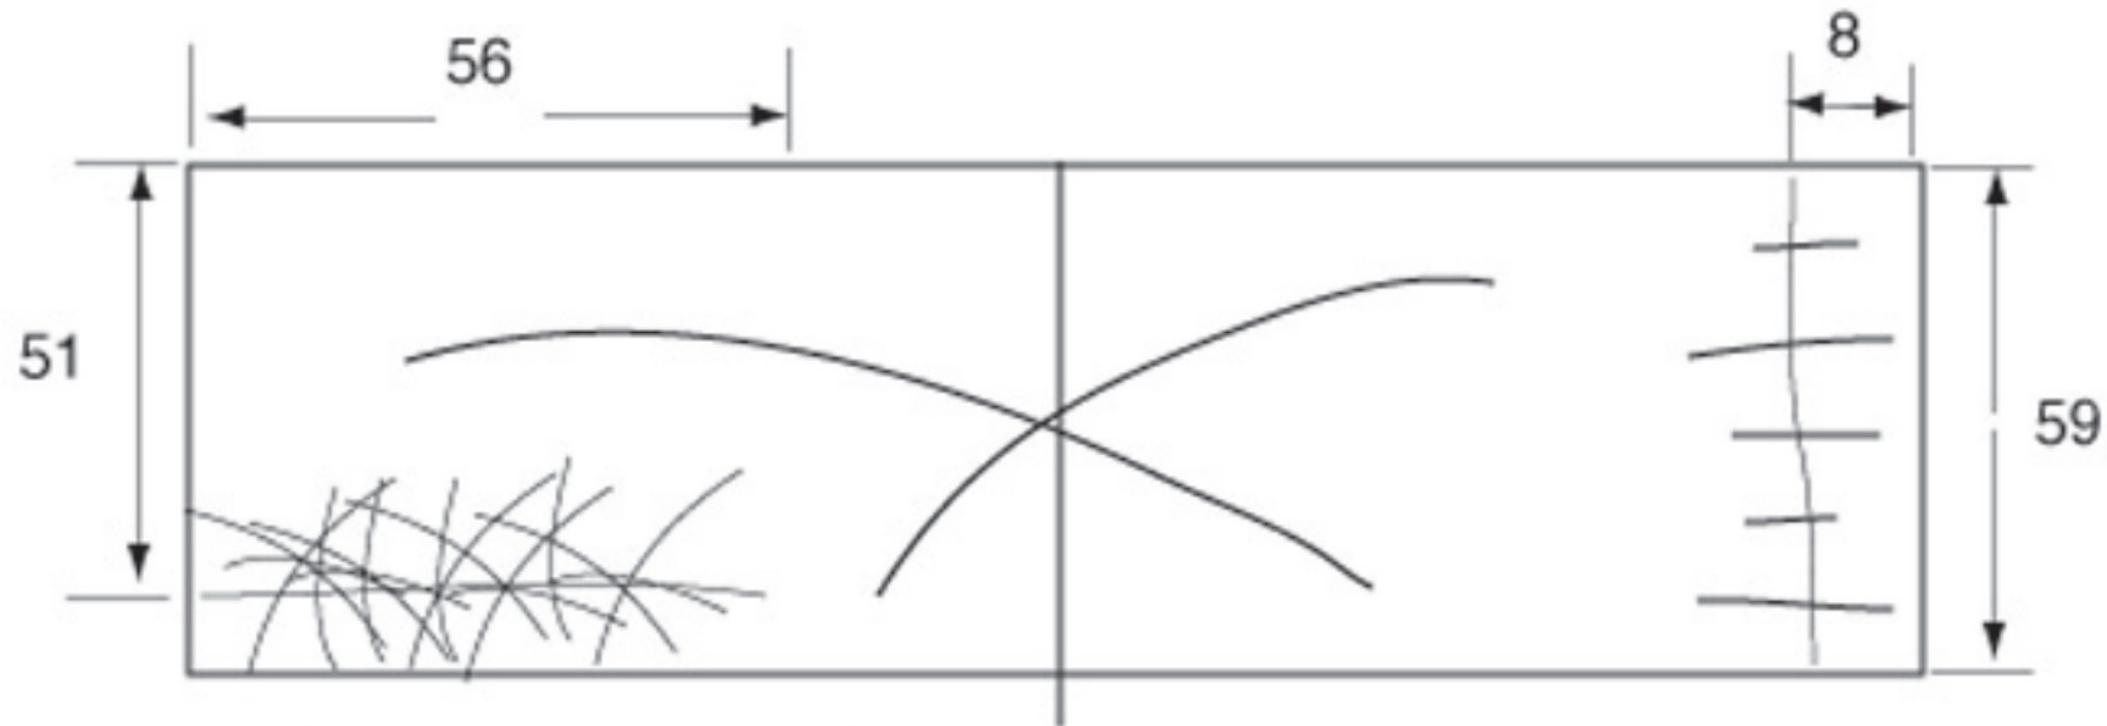

**Windshield cracked on left due to contact by rear hood edge
and on right due to body distortion**


1 = Definitely 2 = Probably 3 = Possible

INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction		
		Comparison Value	-	Intruded Value			
11	Toepan	240	-	201	=	39	rear
11	Instrument panel	183	-	147	=	36	rear
11	Footwell panel	139	-	117	=	27	right
11	Steering column	154	-	130	=	24	rear
11	Windshield header	174	-	166	=	8	rear
11	Roof siderail	110	-	105	=	5	right
13	Toepan	240	-	224	=	16	rear
13	Instrument panel	182	-	173	=	9	rear

OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Steering-wheel	Dr	chest	bottom half of rim bent forward 9 cm	1
B	Airbag	Dr	Face, Lt. UX	blood stains	1
C	Knee bolster	Dr	Rt. leg	scuffmarks	1
D	Foot controls	DR	feet	deflected to right	1
E	vertical console	RF	Lt. leg	side panel scuffmarks	1
F	Mid instrument panel cover	RF	Lt. UX	scuffmark	1
G	Glove box	RF	Lt. LX	scuffmark	1
H					
I					
J					

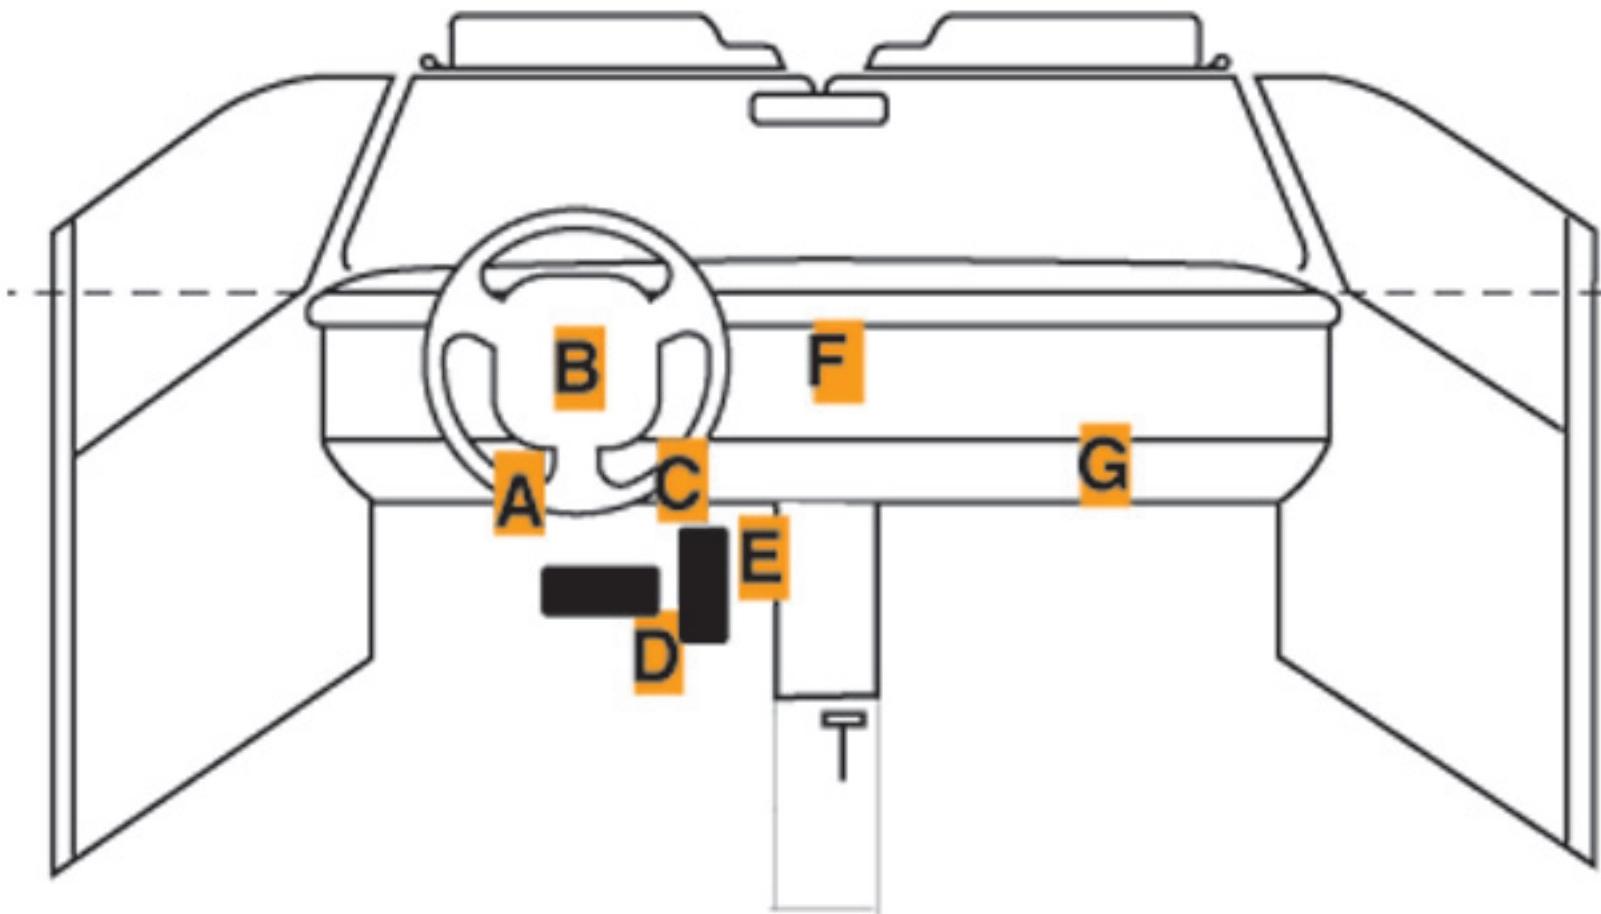

A = bottom half of steering wheel
rim, bent forward 9 cm

B = airbag, blood stains

C = knee bolster, scuffmarks


D = foot controls, deflected to right

E = vertical console side panel, scuffmarks


F = mid instrument panel cover, scuffmark

G = glove box door, scuffmark

Driver Airbag

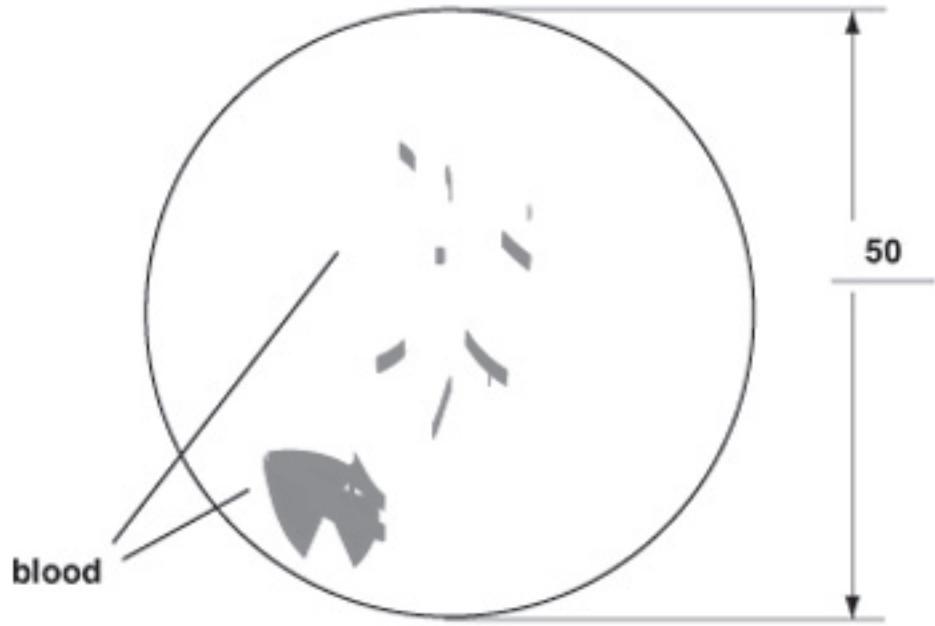

Driver Airbag Door

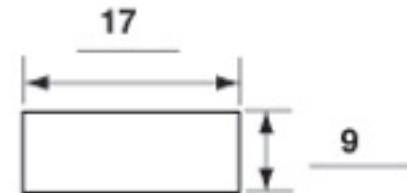

Vents: Y N


if yes, how many: 2

at 1 and 11 o'clock


Tethers: Y N

if yes, how many: 2

Passenger Airbag

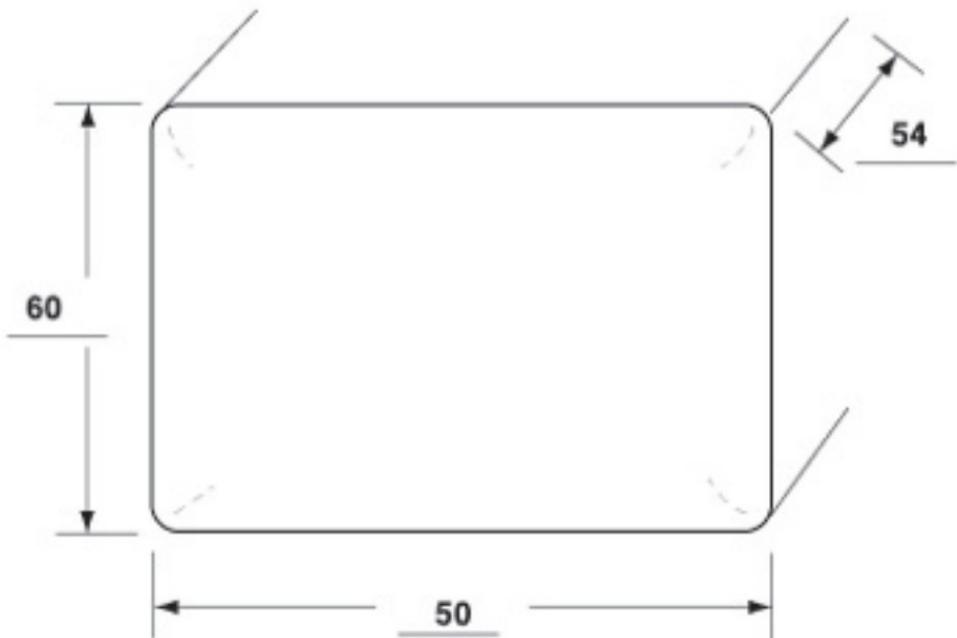

Passenger Airbag Door

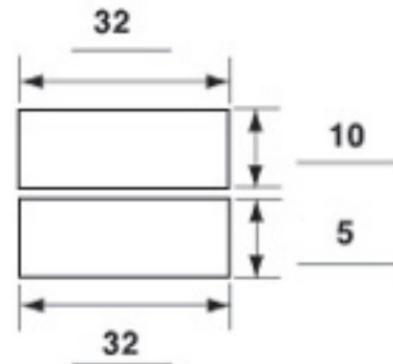

Vents: Y N 2
if yes, how many: _____
3 and 9 o'clock on sides

Tethers: Y N 2
if yes, how many: _____

Case # 367: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	38	Other (e.g. fire)	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	19	Superior/upper	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FSLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	38	Other (e.g. fire)	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	09	Inferior/lower	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FILI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	38	Other (e.g. fire)	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	01	Abrasions	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FRAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	more
V2102 — 1st Prob Contact Area	38	Other (e.g. fire)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	23	Wrist/hand	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	WRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	01	Arm (upper)	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	ARCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	18	Forearm	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	RRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	more
V2102 — 1st Prob Contact Area	32	Other occupant(s)	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	05	Elbow	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	ERCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	CRFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	CRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	13	Abdomen	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	MLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #11

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	11	Injury #11	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	05	Instrument panel (specific area unknown)	more
V2104 — Primary OIC -body Region	23	Wrist/hand	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	WLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #12

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	12	Injury #12	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	05	Instrument panel (specific area unknown)	more
V2104 — Primary OIC -body Region	23	Wrist/hand	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	WLLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #13

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	13	Injury #13	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	CLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #14

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	14	Injury #14	more
V2102 — 1st Prob Contact Area	99	Unknown area of contact	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	16	Pulmonary/lungs	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	CLCP3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #15

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	15	Injury #15	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	19	Shoulder	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	SLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #16

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	16	Injury #16	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	20	Thigh	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	TLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #17

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	17	Injury #17	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	12	Leg (lower)	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	LLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #18

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	18	Injury #18	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	12	Leg (lower)	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	LLFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #19

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	19	Injury #19	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QLFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #20

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	20	Injury #20	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	QLFS1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #21

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	21	Injury #21	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	QLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1; Injury #22

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	22	Injury #22	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	03	Central	more
V2106 — Primary OIC -lesion	01	Abrasions	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FCAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	13	Abdomen	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	MLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	13	Abdomen	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	MRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	01	Abrasions	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	PLAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	16	Pelvic/hip	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	01	Abrasions	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	PRAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	more
V2102 — 1st Prob Contact Area	55	Middle instrument panel	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	18	Forearm	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	RLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	more
V2102 — 1st Prob Contact Area	55	Middle instrument panel	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	18	Forearm	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	RLFS3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	02	Glove compartment area	more
V2104 — Primary OIC -body Region	11	Knee	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	KLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	02	Glove compartment area	more
V2104 — Primary OIC -body Region	11	Knee	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	KRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	02	Glove compartment area	more
V2104 — Primary OIC -body Region	11	Knee	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	01	Abrasions	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	KRAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury #11

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	11	Injury #11	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury #12

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	12	Injury #12	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 2; Injury #13

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	13	Injury #13	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 367: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	more
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	more
V2003 — Occupant Position -row	1	1st row	more
V2004 — Occupant Position -lateral	1	Left	more
V2005 — Occupant Position -posture	10	Sitting on seat	more
V2006 — Occupant Age In Years	61	—	—
V2007 — Occupant Age In Months	25	25 months or older	more
V2008 — Occupant Mass	082 kg	—	—
V2009 — Occupant Height	175 cm	—	—
V2010 — Occupant Sex	1	Male	more
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	more
V2012 — Injury Severity Score	19	—	—
V2013 — Non-impact Med Condition	0	None	more
V2014 — Police Injury Severity	3	A - Incapacitating Injury	more
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	more
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	more
V2017 — Passive Restraint System	1	Air bag installed	more
V2018 — Passive Restraint Usage	2	Air bag deployed	more
V2019 — Child Seat Type	88	Not applicable (adult or older child)	more
V2020 — Occupant Ejection Degree	0	None	more
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	more
V2022 — Highest OIC Severity	3	Serious	more

V2023 — Head Restraint Available	1	Equipped	more
V2024 — Occupant Eyewear	1	Glasses	more
V2025 — Source of Occupant Info	7	Combination of above	more

Case # 367: Occupant # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	02	Occupant #2	more
V2002 — Occupant Role At 1st Impact	2	Motor vehicle passenger	more
V2003 — Occupant Position -row	1	1st row	more
V2004 — Occupant Position -lateral	5	Right	more
V2005 — Occupant Position -posture	10	Sitting on seat	more
V2006 — Occupant Age In Years	49	—	—
V2007 — Occupant Age In Months	25	25 months or older	more
V2008 — Occupant Mass	066 kg	—	—
V2009 — Occupant Height	165 cm	—	—
V2010 — Occupant Sex	2	Female	more
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	more
V2012 — Injury Severity Score	10	ISS 10	more
V2013 — Non-impact Med Condition	0	None	more
V2014 — Police Injury Severity	3	A - Incapacitating Injury	more
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	more
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	more
V2017 — Passive Restraint System	1	Air bag installed	more
V2018 — Passive Restraint Usage	2	Air bag deployed	more
V2019 — Child Seat Type	88	Not applicable (adult or older child)	more
V2020 — Occupant Ejection Degree	0	None	more
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	more

V2022 — Highest OIC Severity	3	Serious	more
V2023 — Head Restraint Available	1	Equipped	more
V2024 — Occupant Eyewear	1	Glasses	more
V2025 — Source of Occupant Info	7	Combination of above	more




































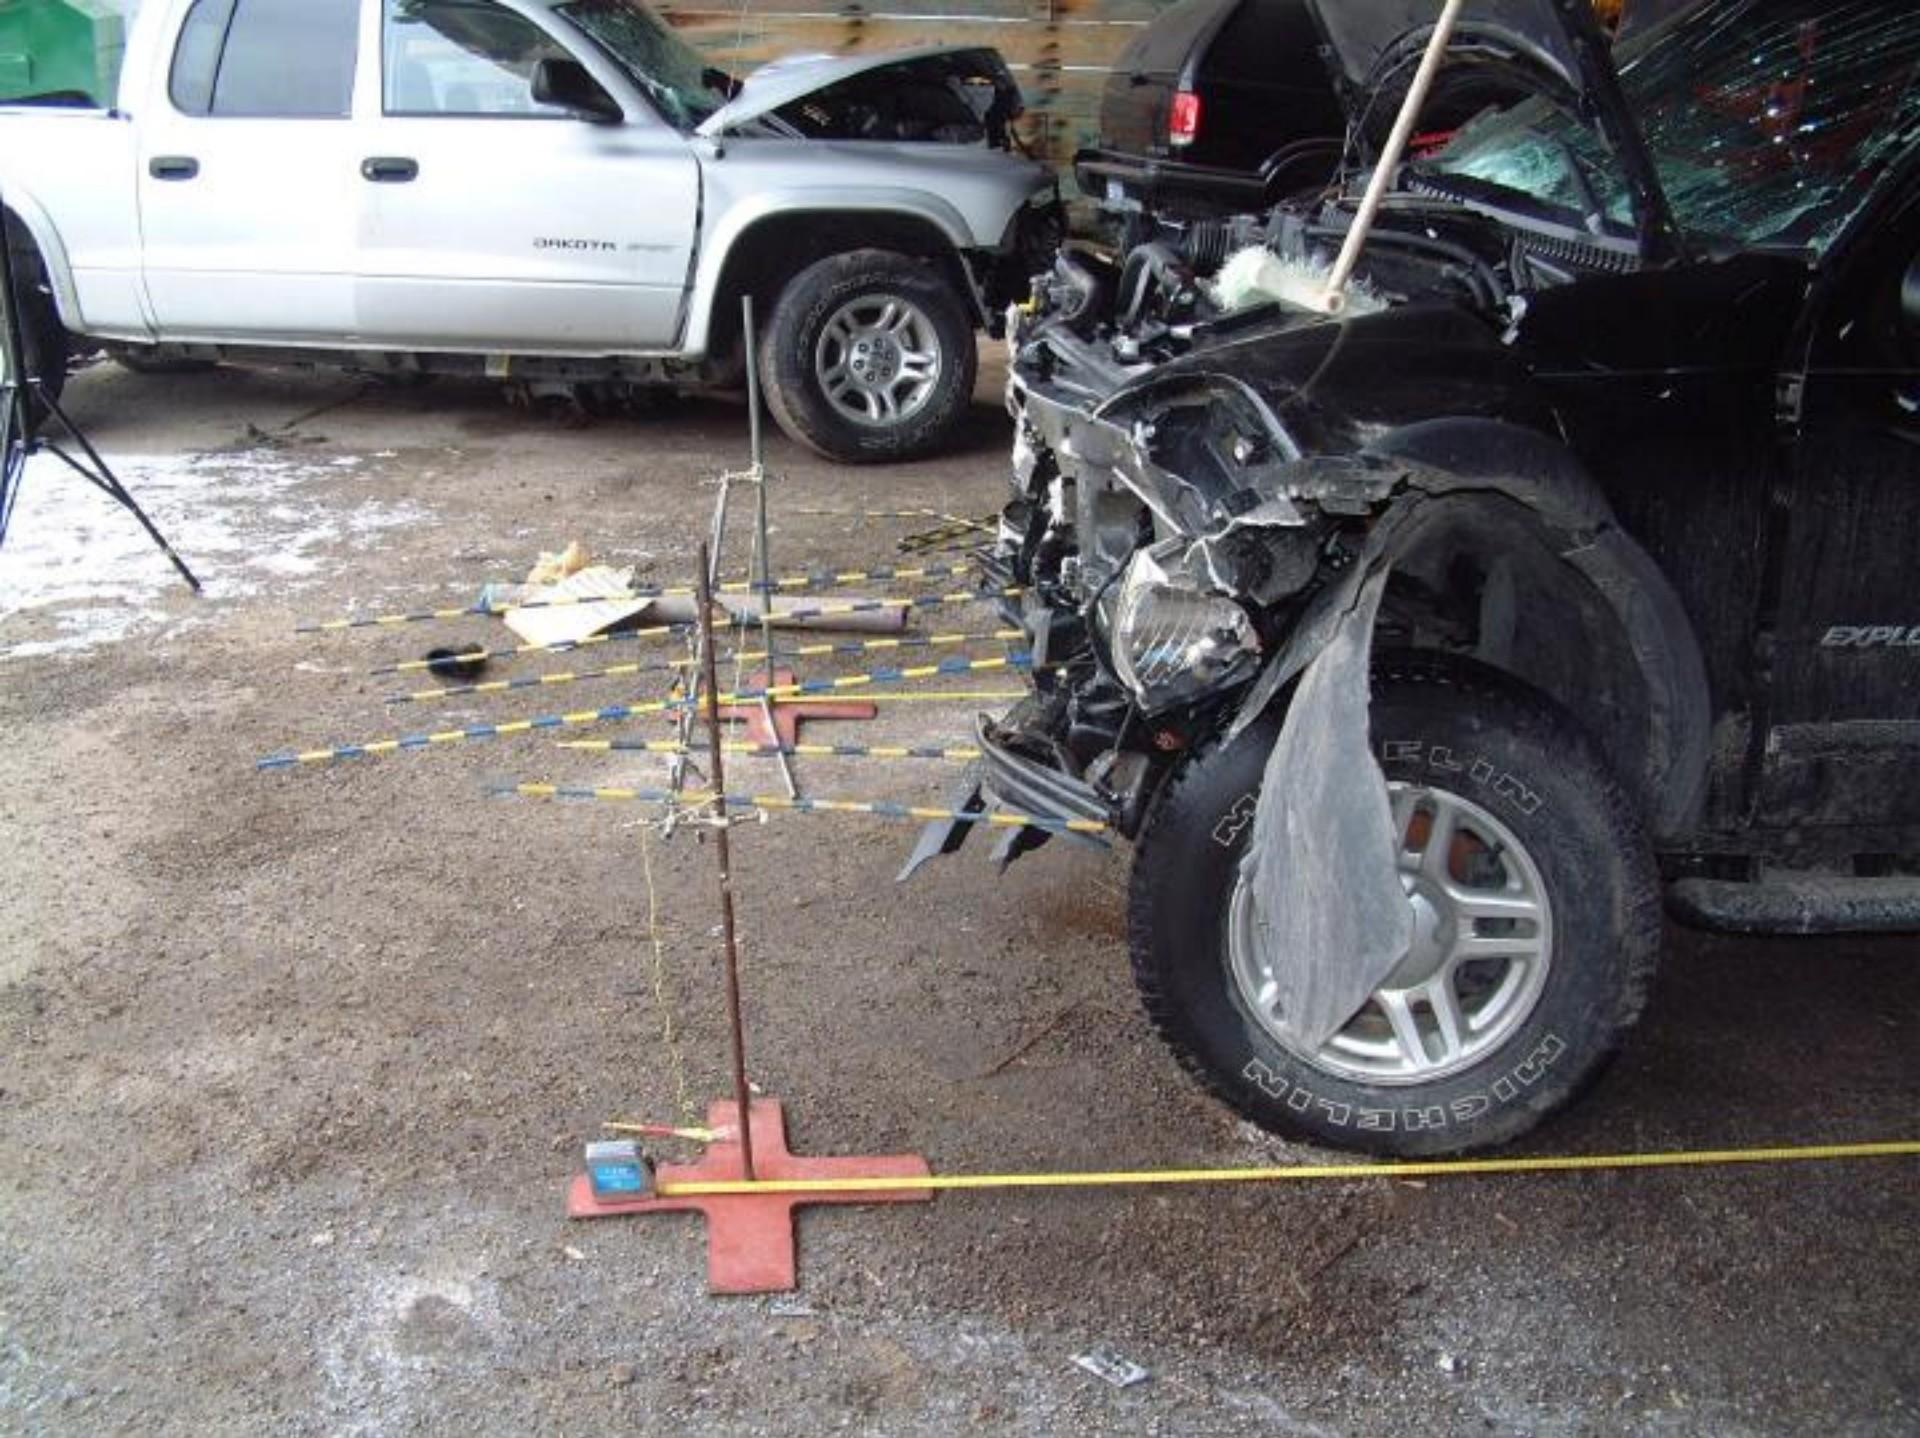












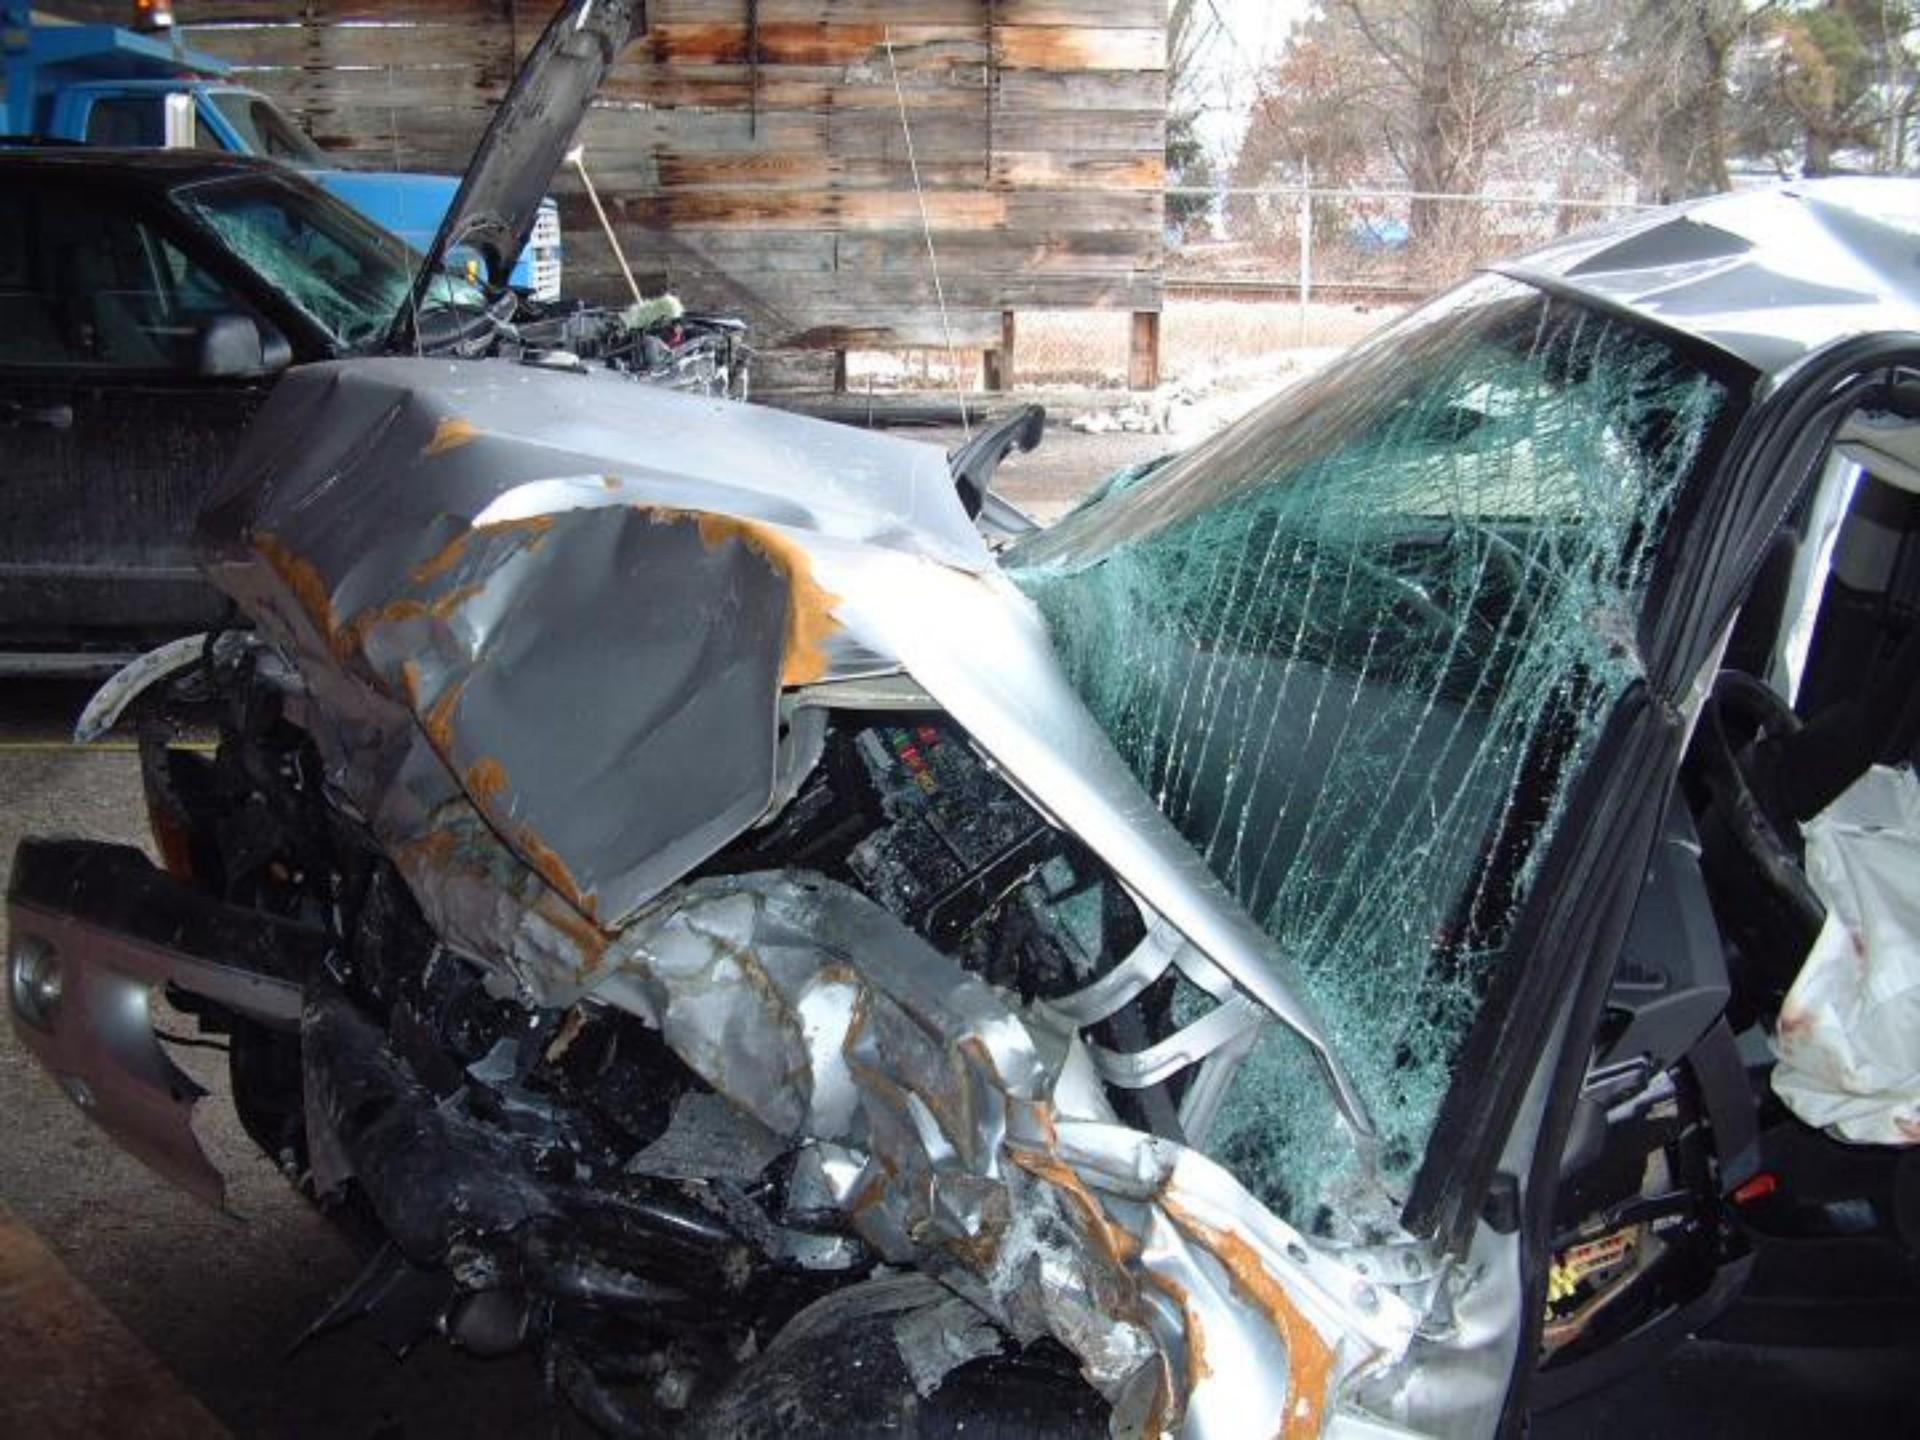




























DODGE



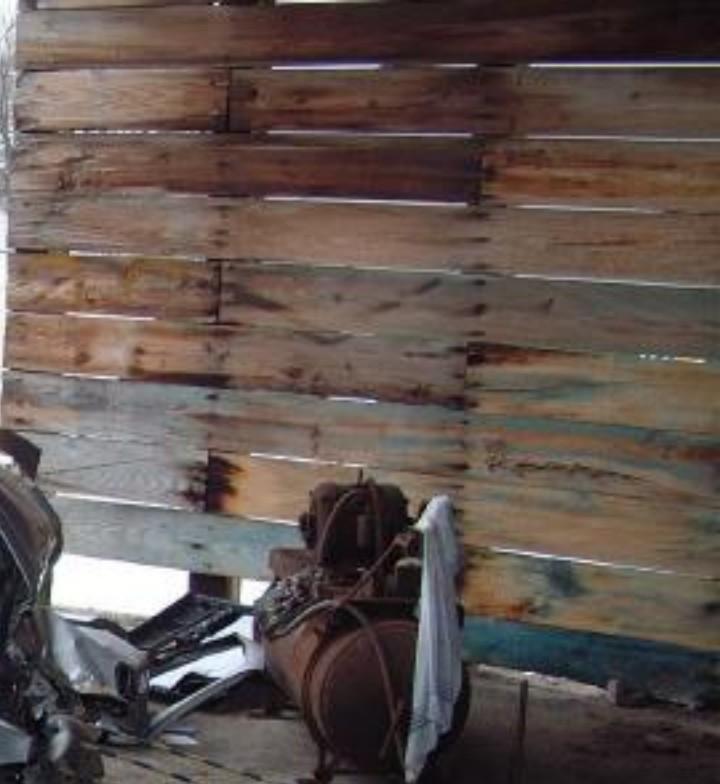







A yellow measuring tape is stretched horizontally across a large, white, crumpled fabric item, possibly a bedsheet or duvet cover. The tape measure is marked in inches, with visible numbers from 1 to 22. The fabric is heavily wrinkled and folded, creating many creases and wrinkles across the surface. The background is dark, making the white fabric stand out.

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22



































HOOD

WARNING
DANGER
EXHAUST GAS
INLET









10 11 12 13 14 15 16 17 18 19 20

30 29 28 27 26 25 24 23 22 21 20

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37







WARNING

REAR SEAT REAR
SEAT CAN DECOR









































